## Stoughton PC - Gaulby Lane Play Area

Asset Name	Standard Description	Finding Notes	Task Title	Risk Score	Risk Level
Agility - Balance Trail	Strimmer damage is present on posts, allowing water to	Strimmer damage is present on posts, allowing water	Prevent further damage.	8	Medium
	enter and timbers to soften. It can also remove the	to enter and timbers to soften. Prevent further			
	protective envelope around the timber. Prevent further	damage and check timbers for decay throughout the			
Agility - Balance Trail	Bolt(s) loose.	Multiple loose panels.	Tighten.	6	Low
Agility - Roller Balance Beam	The supporting components should be dismantled and	Unit has limited movement.	Dismantle and inspect according to manufacturer's	8	Medium
	inspected according to the manufacturer's instructions.		instructions.		
	This will need doing on a regular basis, as defined by the				
	manufacturer. This can lead to a high risk if no action is				
Agility - Roller Balance Beam	There are natural splits / shakes in the timbers.	Monitor shakes for decay.	Shakes vary. Monitor and consult manufacturer if	7	7 Low
		Monitor all natural timber shakes. Shakes are creating	dimensions exceed 8 mm at sections used to grip /		
		slight splintering. Smooth off if necessary.	grasp.		
Agility - Wobble Board	Item is rusting in places.	Spring connectors.	Descale.	7	7 Low
Basketball Post	Risk assessment.	Balls may leave the area and strike a user of the play	Read the notes for further action.	7	7 Low
		equipment.			
Basketball Post	Loose in ground.	Slightly loose in the ground socket and leaning	Read the notes for further action.	6	Low
Carousel - Dizzy Discs x 2	Bearings require service.		Service the bearings.	8	Medium
Carousel - Dizzy Discs x 2	Item is not secure.	Both rubber tops.	Secure.	5	Low
Carousel - Turnstile	Bearings require service.		Service the bearings.	9	Medium
Climber - Rota Web	Surface is uneven.		Make good.	5	Low
Football Goal	Loose in ground.		Repair.	8	Medium
Football Goal	Mole hills present.	Throughout.	Eliminate.	7	7 Low
Football Goal	Risk assessment.	Balls may leave the area and strike a user of the play equipment.	Read the notes for further action.	7	Low
Multiplay - Senior	Timber is not in good condition.	Several timbers throughout unit. Replace affected	Replace.	13	High
		parts.	·		
Multiplay - Senior	Item is damaged.	Replace and repair damaged sections.	Read the notes for further action.	10	Medium
Multiplay - Senior	Chain covers prevent a thorough inspection of all chain	All chain covers are damaged leaving sharp edges.	Remove chain covers to inspect according to	8	Medium
	links.	Replace.	manufacturer's instructions, and replace the covers		
Multiplay - Senior	RoSPA is concerned by accidents on some types of		The protective surface under all bars and rings must	8	Medium
	overhead ladders and rings. However, there is a strong		be kept in good condition.		
Multiplay - Senior	Item edges are worn.	Tyres are worn exposing metal frames. Replace.	Read the notes for further action.	8	Medium
Multiplay - Senior	Finger entrapment.	Slide platform gaps.	Eliminate the entrapment.	8	Medium
		Bridge slats.			
Multiplay - Senior	Algae growth giving slippery conditions.	Surface/the equipment are algae and moss covered,	Powerwashing is recommended. Care should be	7	7 Low
		providing a slippery surface when wet.	taken to ensure that the material can sustain high		<u> </u>
Multiplay - Senior	Some chain wear.		Monitor for further deterioration and replace before	7	7 Low
Multiplay - Senior	Fixtures loose or missing.	Slide tower roof is loose due to missing fixings.	Tighten/replace.	7	7 Low
Multiplay - Toddler	Timber is not in good condition.	Several timbers throughout unit. Replace.	Replace.	11	Medium
Multiplay - Toddler	Finger entrapment.	Platform gaps.	Eliminate the entrapment.	6	Low

Rocker - Dog	The spring is rusty. These have been known to fail without		Monitor.	8	Medium
	warning, leading to a collapse of the unit.				
Rocker - Dog	Fixtures loose or missing.	Rocker body bolts to connectors.	Tighten/replace.	8	Medium
		Cap/s are missing allowing water ingress into the			
		frame and fixtures. Replace.			
Rocker - Dog	Protruding handles / foot rests.		No reasonably practicable action is identified.	3	Very Low
Rocker - Seesaw	Fixtures loose or missing.	Foundation plate is very loose. Secure.	Tighten/replace.	11	Medium
Rocker - Seesaw	Cap missing.		Replace.	5	Low
Rocker - Seesaw	Protruding handles / foot rests.		No reasonably practicable action is identified.	3	Very Low
Rocker - Seesaw - Gullwing	Fixtures loose or missing.	One seat bolt fixtures. Replace.	Tighten/replace.	7	Low
		Hand hold bolts. Tighten.			
Seating - Various	Projecting bolt thread.		Cut off and file down to remove sharp edges or use	6	Low
			the correct length of bolt.		
Seating - Various	Timber is splintered.		Repair.	5	Low
Seating - Various	The equipment is dirty or algae covered.		Clean off.	5	Low
Swing - Junior - 1 Bay 2 Seat	There is wear in the bushes.	One hanger bush.	Remove shackle bolt and check bush and shackle	9	Medium
			pin wear, replacing as necessary.		
Swing - Junior - 1 Bay 2 Seat	Some chain wear.		Monitor for further deterioration and replace before	7	Low
Swing - Junior - 1 Bay 2 Seat	There is wear to the surfacing due to foot drag.		Although the seats are set at an acceptable height it	6	Low
			is recommended that these are raised by 100 mm to		
			help prevent wear.		
Swing - Toddler - 1 Bay 2 Seat	There is wear to the surfacing due to foot drag.		Although the seats are set at an acceptable height it	6	Low
			is recommended that these are raised by 100 mm to		
			help prevent wear.		
Swing - Toddler - 1 Bay 2 Seat	Moving parts require greasing.		Apply lubricant according to the manufacturer's	4	Low